

elcometer®  
inspection equipment



Elcometer 319  
Dewpoint Meter

Elcometer 319 Dewpoint Meter

This rugged gauge is designed to measure and record all relevant climatic parameters required to determine whether the conditions are suitable for painting.



A hand-held Dewpoint meter with both manual and automatic data logging in one gauge

Robust temperature sensors

Integrated magnets allow the gauge to be attached to the substrate during remote logging

Easy to use, intuitive menu structure

Visual and audible indication of user defined limits for any or all parameters

Dustproof and waterproof gauge with fully sealed sensors (equivalent to IP66)

Stores 25,000 records in up to 999 batches

Gauges can be recertified at Elcometer Authorised Service Centres

Suitable for use in Cloud Computing

2 YEAR\* WARRANTY

Made for iPod iPhone iPad

Android™

available with Bluetooth® wireless technology

compatible with ElcoMaster®

Elcometer 319 Model T: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5c, iPhone 5, iPhone 4s, iPhone 4, iPad Air 2, iPad mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad mini, iPad 2, and iPod touch (4th and 5th generation). "Made for iPod," "Made for iPhone," and "Made for iPad" mean that an electronic accessory has been designed to connect specifically to iPod touch, iPhone, or iPad, respectively, and has been certified by the developer to meet Apple performance standards. Apple is not responsible for the operation of this device or its compliance with safety and regulatory standards. Please note that the use of this accessory with iPod touch, iPhone, or iPad may affect wireless performance.

## Dewpoint Meter

## Elcometer 319

### Measure and record climatic parameters:

- Relative humidity
- Air temperature
- Surface temperature
- Dewpoint temperature
- $T_{\Delta}$  (the difference between surface temperature and dewpoint)
- Dry Bulb temperature
- Wet Bulb temperature
- External temperature correction (K-type)
- Specific Humidity



### Flexible

The Elcometer 319 can be used as either a hand-held dewpoint meter or as a remote data logging monitor.<sup>†</sup>

### Designed to last

Robust, durable & weather resistant, the Elcometer 319 is available with a 2 year\* manufacturer's warranty; giving you piece of mind.

### Data output to PC, Android™ or iOS mobile device

Connect the Elcometer 319 via Bluetooth® or USB to a PC, Android™ or iOS mobile device & download the data into an inspection application or into ElcoMaster® for instant report generation.



USB and Bluetooth® data output to ElcoMaster® software

The latest National and International Standards have been identified. Those in Orange are current and those in Grey have been superseded but are still recognised in some industries.

<sup>†</sup> Model T only

\* The Elcometer 319 gauges are supplied with a one year warranty against manufacturing defects. The warranty can be extended to two years via [www.elcometer.com](http://www.elcometer.com).

#### STANDARDS:

BS 7079-B4, IMO MSC.215(82),  
IMO MSC.244(83), ISO 8502-4,  
US Navy NSI 009-32,  
US Navy PPI 63101-000



Large easy to read measurements in degrees °C or °F



View up to 5 user selectable statistics on screen



Review individual readings

### Accurate

- Meets ISO 8502-4
- Each instrument is supplied with a Calibration Certificate
- Readings are switchable between Celsius and Fahrenheit
- All readings are time & date stamped

### Simple

- Easy menu-driven user interface in multiple languages
- Clear, illuminated display showing up to five user-defined parameters
- Arrow indicators show temperature trends

### Flexible

- The gauge can be used as either a hand-held Dewpoint meter or as a remote data logging monitor<sup>†</sup>
- Integrated K-Type connector allows measurement of surface temperature during remote logging using a remote probe
- Using an external probe the “Te” mode transforms the gauge into a thermometer - ideal for measuring temperature of a paint prior to application
- Hold/freeze function allows manual readings to be reviewed before being added into the memory

### Durable

- Safe use in climates ranging between -20°C (-4°F) and +80°C (+176°F)
- Waterproof and dust proof rating equivalent to IP66
- Rugged and ergonomic design, re-engineered sensors have greater durability for an extended life

### Versatile

- Rapid response time
- Data can be downloaded to a PC via USB or Bluetooth® and evaluated using ElcoMaster® Software<sup>†</sup>
- Each gauge can be powered by either 2 AA batteries (for up to 400 hours<sup>#</sup> use) or directly via the USB cable
- Adjustable limits can be set for each measurement parameter which trigger visual and audible alarms whenever a limit is exceeded
- Intelligent memory calculates total available logging time when using batches
- Gauges can be recertified at Elcometer Authorised Service Centres

<sup>†</sup>Model T only.

<sup>#</sup>Based on 1 reading every 10 minutes in logging mode.



Te - Ideal for use as a simple thermometer



Waterproof and rugged to IP66



Remote monitoring of climatic parameters

## Dewpoint Meter

## Elcometer 319

## Technical Specification

C

| Model                                                                                                    | Model S                                                                                                                                                                        | Model T                                | Certificate   |
|----------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|---------------|
| Part Number                                                                                              | G319----S                                                                                                                                                                      | G319----T                              | ●             |
| Reading Parameters -<br>RH, Ta, Ts (Te <sup>6</sup> ), Td, TΔ, Tdb, Twb <sup>1</sup> , SH <sup>1</sup>   | ■                                                                                                                                                                              | ■                                      |               |
| Statistics - number of readings, standard deviation,<br>mean, coefficient of variation, minimum, maximum | ■                                                                                                                                                                              | ■                                      |               |
| Dustproof & Waterproof Gauge with Fully Sealed<br>Sensors - equivalent to IP66                           | ■                                                                                                                                                                              | ■                                      |               |
| Integral Magnets - secure the gauge during logging                                                       | ■                                                                                                                                                                              | ■                                      |               |
| High/Low Limits - audible, visual, red/green LED<br>alarms can be set against any or all parameters      | ■                                                                                                                                                                              | ■                                      |               |
| Multilingual Menus                                                                                       | ■                                                                                                                                                                              | ■                                      |               |
| Backlight - user selectable                                                                              | ■                                                                                                                                                                              | ■                                      |               |
| K-Type Connector for External Measurement                                                                | ■                                                                                                                                                                              | ■                                      |               |
| Memory - with reading and statistic review                                                               | Last 10 records                                                                                                                                                                | 25,000 records in 999 batches          |               |
| Manual Logging                                                                                           | ■                                                                                                                                                                              | ■                                      |               |
| Interval Logging <sup>2</sup>                                                                            |                                                                                                                                                                                | Adjustable between 1 second and 1 hour |               |
| Data Output                                                                                              |                                                                                                                                                                                |                                        |               |
| USB                                                                                                      |                                                                                                                                                                                | ■                                      |               |
| Bluetooth® to computer, Android™ & iOS <sup>4</sup> devices                                              |                                                                                                                                                                                | ■                                      |               |
| ElcoMaster® software & USB cable                                                                         |                                                                                                                                                                                | ■                                      |               |
|                                                                                                          | Temperature Range                                                                                                                                                              | Accuracy                               | Resolution    |
| Gauge <sup>5</sup>                                                                                       | -20 to +80°C (-4 to +176°F)                                                                                                                                                    | ±0.5°C (±1°F)                          | 0.1°C (0.1°F) |
| Air Temperature (Ta)                                                                                     | -20 to +80°C (-4 to +176°F)                                                                                                                                                    | ±0.5°C (±1°F) <sup>7</sup>             | 0.1°C (0.1°F) |
| Surface Temperature (TS)                                                                                 | -20 to +80°C (-4 to +176°F)                                                                                                                                                    | ±0.5°C (±1°F)                          | 0.1°C (0.1°F) |
| External K-Type Thermocouple (Te)                                                                        | -40 to +200°C (-40 to +392°F)                                                                                                                                                  | ±0.5°C (±1°F) <sup>6</sup>             | 0.1°C (0.1°F) |
| Relative Humidity (RH)                                                                                   | 0 to 100%RH                                                                                                                                                                    | ±3%RH <sup>3</sup>                     | 0.1%          |
| Gauge & LCD Operating Range                                                                              | -20°C to +80°C (-4°F to +176°F)                                                                                                                                                |                                        |               |
| Power Supply                                                                                             | 2 x AA batteries or via USB Cable                                                                                                                                              |                                        |               |
| Battery Life                                                                                             | Manual Mode: Greater than 40 hours (Backlight Off)<br>Interval Logging: up to 400 hours (1 reading every 10 minutes)                                                           |                                        |               |
| Dimensions                                                                                               | 180 x 75 x 35mm (7 x 3 x 1.4")                                                                                                                                                 | Weight                                 | 300g (0.66lb) |
| Packing List                                                                                             | Elcometer 319 Dewpoint Meter, 2 x AA batteries, wrist strap, carry case, calibration certificate, USB cable <sup>†</sup> , ElcoMaster <sup>®†</sup> and operating instructions |                                        |               |

## Accessories

|           |                                                                  |
|-----------|------------------------------------------------------------------|
| T31920162 | Magnetic Surface Temperature Probe; -40 to +80°C (-40 to +176°F) |
| T9996390- | Liquid Temperature Probe; -200 to +1100°C (-328 to +2012°F)      |
| T99921325 | USB Cable                                                        |
| T99916063 | Wrist Strap                                                      |
| T99923480 | Protective Carry Case/Pouch                                      |

<sup>1</sup> Calculated Value<sup>2</sup> With Part Number T31920162<sup>3</sup> at 1m/s<sup>4</sup> Visit [www.elcometer.com/sdk](http://www.elcometer.com/sdk) to find out how to integrate Elcometer's MFi certified products to your App.<sup>5</sup> Do not expose the gauge to temperatures outside the gauge and LCD operating range<sup>6</sup> Accuracy ±2°C (4°F) with K Type probes supplied by Elcometer. Gauge tested with voltage input<sup>7</sup> Accuracy ±0.75°C below 10°C (±1.35°F below 50°F) <sup>†</sup>Model T only.

● Certificate supplied as standard.



## Elcometer 319

## Dewpoint meter

Create instant reports with ElcoMaster®

What you do with the collected data is just as important as taking the readings themselves.



ElcoMaster® is a fast, easy to use software solution for all your data management and quality assurance needs, preparing professional inspection reports at the click of a button.

Data transferred to ElcoMaster® includes;

- RH, Ta, Ts, Td, TΔ, Tdb, Twb, SH readings
- Date & time for each reading
- Batch information & statistics

Whether you are in the field or on the factory floor, using the ElcoMaster® Mobile App users can;

- Store live readings directly on to a mobile device and save them into batches
- View graphs in real-time whilst carrying out the inspection
- Add notes to individual batch reading
- Add photographs of the test surface to each individual batch reading at the click of a button
- Plot individual readings on to a location Map photograph or diagram via the mobile device's internal GPS
- Inspection data can be transferred from mobile to PC for further analysis and reporting
- Generate instant .pdf report for submission

## Dewpoint meter

## Elcometer 319

### Connect

Connect gauge via Bluetooth® to see live readings directly on the phone and save them into batches.

### Review

Review average, maximum and minimum readings instantly.

### Manage & Print

Store all data; gloss, dry film thickness, surface profile, climate and manual reports in easy to manage folders.

### Photos & Notes

Add photos, notes and comments.

### Image Collection

Use measurement location points on images to indicate the position for the next reading.

### Combine


Combine different inspection parameters (such as climate, DFT, surface profile, surface cleanliness and adhesion) together with images, notes and other project specific information into reports.

### Collaborate

Share inspection data securely via the Cloud and collaborate on projects using the instant messaging feature in ElcoMaster®.


### Send

Email inspection data from a mobile device to a PC for further analysis and reporting or transfer data via the Cloud.

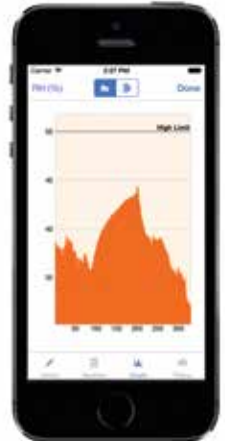


| Item       | Value | Unit |
|------------|-------|------|
| Average    | 10.0  | mm   |
| Maximum    | 15.0  | mm   |
| Minimum    | 5.0   | mm   |
| Range      | 10.0  | mm   |
| High Limit | 20.0  | mm   |
| Low Limit  | 0.0   | mm   |

| Point | Value |
|-------|-------|
| 1     | 36.7  |
| 2     | 36.6  |
| 3     | 36.5  |
| 4     | 36.7  |
| 5     | 36.3  |
| 6     | 36.0  |
| 7     | 36.3  |

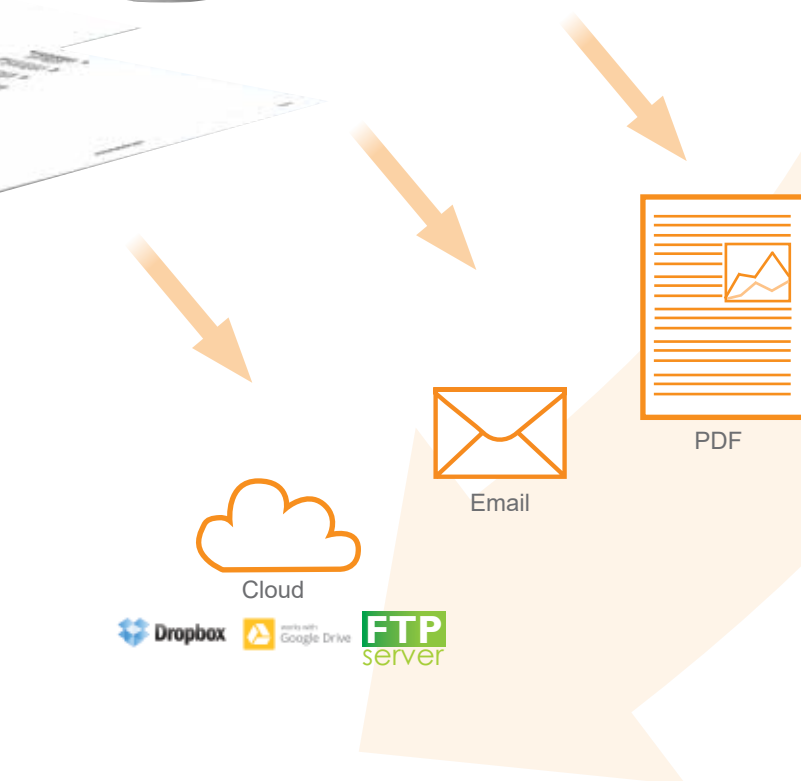

PC



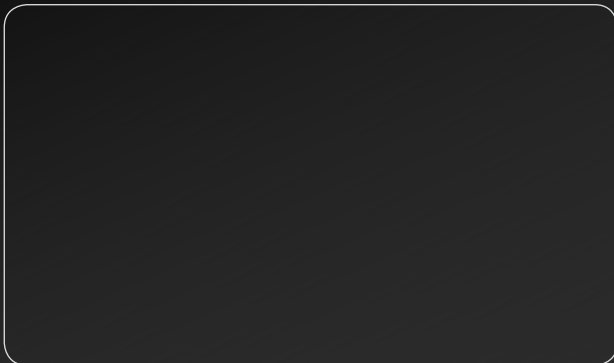

**elcometer®**  
www.elcometer.com

elcometer.be • elcometer.fr • elcometer.de • elcometer.nl  
elcometer.jp • elcometer.ae • elcometer.com.sg

Elcometer 319 Model T: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5c, iPhone 5, iPhone 4s, iPhone 4, iPad Air 2, iPad mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad mini, iPad 2, and iPod touch (4th and 5th generation). "Made for iPod," "Made for iPhone," and "Made for iPad" mean that an electronic accessory has been designed to connect specifically to iPod touch, iPhone, or iPad, respectively, and has been certified by the developer to meet Apple performance standards. Apple is not responsible for the operation of this device or its compliance with safety and regulatory standards. Please note that the use of this accessory with iPod touch, iPhone, or iPad may affect wireless performance.

iPad, iPhone, and iPod touch are trademarks of Apple Inc., registered in the U.S. and other countries. App Store is a trademark of Apple Inc., registered in the U.S. and other countries. Suitable for mobile devices running Android software version 2.1 and upwards. Elcometer is a registered trademark of Elcometer Limited. All other trademarks acknowledged.

© Elcometer Limited, 2017. All rights reserved. No part of this document may be reproduced, transmitted, stored (in a retrieval system or otherwise), or translated into any language, in any form, or by any means, without the prior written permission of Elcometer Limited.

Due to our policy of continuous improvement, Elcometer Limited reserves the right to change specifications without notice. All gauges come with a 1 year warranty as standard, the Elcometer 319 is extendable within 60 days from date of purchase, free of charge, to 2 years via www.elcometer.com

## ENGLAND

Elcometer Limited  
Manchester M43 6BU  
Tel: +44 (0)161 371 6000  
Fax: +44 (0)161 371 6010  
sales@elcometer.com  
www.elcometer.com

## BELGIUM

Elcometer SA  
Tel: +32 (0)4 379 96 10  
Fax: +32 (0)4 374 06 03  
be\_info@elcometer.com  
www.elcometer.be

## FRANCE

Elcometer Sarl  
Tel: +33 (0)2 38 86 33 44  
Fax: +33 (0)2 38 91 37 66  
fr\_info@elcometer.com  
www.elcometer.fr

## GERMANY

Elcometer Instruments GmbH  
Tel: +49(0)7361 52806 0  
Fax: +49(0)7361 52806 77  
de\_info@elcometer.com  
www.elcometer.de

## THE NETHERLANDS

Elcometer B.V.  
Tel: +31 (0)30 259 1818  
Fax: +31 (0)30 210 6666  
nl\_info@elcometer.com  
www.elcometer.nl

## JAPAN

Elcometer KK  
Tel: +81-(0)3-6869-0770  
Fax: +81-(0)3-6433-1220  
jp\_info@elcometer.com  
www.elcometer.jp

## REPUBLIC OF SINGAPORE

Elcometer (Asia) Pte Ltd  
Tel: +65 6462 2822  
Fax: +65 6462 2860  
asia@elcometer.com  
www.elcometer.com.sg

## UNITED ARAB EMIRATES

EL Inspection & Blasting  
Equipment LLC  
Tel: +971 4 295 0191  
Fax: +971 4 295 0192  
uae\_sales@elcometer.com  
www.elcometer.ae

## USA

MICHIGAN  
Elcometer Inc  
Tel: +1 248 650 0500  
Toll Free: 800 521 0635  
Fax: +1 248 650 0501  
inc@elcometer.com  
www.elcometer.com

## TEXAS

Elcometer of Houston  
Tel: +1 713 450 0631  
Toll Free: 800 521 0635  
Fax: +1 713 450 0632  
inc@elcometer.com  
www.elcometer.com